

Part 573 Safety Recall Report**16V-313****Manufacturer Name :** Spartan Motors USA**Submission Date :** MAY 13, 2016**NHTSA Recall No. :** 16V-313**Manufacturer Recall No. :** 16014**Manufacturer Information :**

Manufacturer Name : Spartan Motors USA

Address : 1541 Reynolds Road

Charlotte MI 48813

Company phone : 517-543-6400

Population :

Number of potentially involved : 2,582

Estimated percentage with defect : 1

Vehicle Information :

Vehicle : 2007-2015 Spartan Specialty Vehicle MM and K3

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : Incomplete chassis affected by this recall were to be completed as motorhomes by a final stage manufacturers.

Production Dates : SEP 21, 2006 - MAR 23, 2015

VIN (Vehicle Identification Number) Range

Begin : NR

End : NR

 Not sequential VINs**Description of Defect :**

Description of the Defect : The exhaust flex tube may be misaligned causing the potential for the flex tube to tear. If the exhaust tube tears, hot exhaust gas could blow against other components or material.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If exhaust gas temperatures exceed the flash point of other material or components, it could increase the risk of fire.

Description of the Cause : NR

Identification of Any Warning that can Occur : A tear in the exhaust tube may occur without warning.

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

Chronology :

January 2016, warranty claims relating to exhaust tubes cracking were identified. An in depth warranty review was initiated. March - April 2016, an is/is not study was conducted to determine what variations might exist in addition to physical testing. On May 6, 2016, information was summarized before the Campaign Approval Board and a safety defect was determined to exist in product models and model years identified in this defect information report.

Description of Remedy :

Description of Remedy Program : The alignment of the exhaust tube will need to be inspected. If a misalignment is identified, the tube will be aligned appropriately. If there is a tear in the exhaust tube, it will be replaced. The inspection and if needed, the exhaust tube replacement will be performed free of charge.

How Remedy Component Differs from Recalled Component : The flex tube would be aligned appropriately on certain motor home chassis.

Identify How/When Recall Condition was Corrected in Production : Pending

Recall Schedule :

Description of Recall Schedule : Spartan does not have dealers for this product type and will not issue a dealer letter. However, a final stage manufacturer will be provided to affected final stage manufacturers. A sample has been provided and Spartan will distribute within 5 business days.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : MAY 27, 2016 - MAY 27, 2016

* NR - Not Reported